

Model: EXI800 Top Drives
Serial #: See affected units

Jul. 19, 2019

Product Bulletin # TDS-201

Alert



Oil Cooler Mounting Bracket

Canrig advises all operators of EXI800 older model top drives (with a mechanical driven lubrication pump) to perform an immediate visual inspection of the oil cooler mounting bracket. Look for cracks or damage, in particular the mounting plates on the sides of the cooler as indicated in Figure 1 below.

Affected Units

Canrig Top Drives older model EXI800 with a mechanical driven lubrication pump.

If a side plate is cracked or broken, **stop operations immediately** and contact RIGLINE 24/7TM Support for a remedial action plan. If no cracks or broken side plates are found, proceed with operations and continue the daily inspection requirement as per the corresponding top drive maintenance manual.

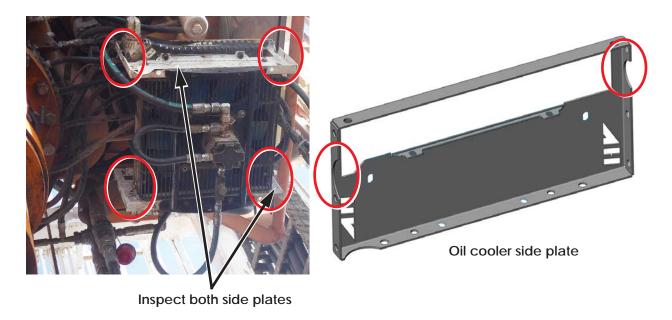


Figure 1: Oil Cooler Mounting Bracket Inspection Locations